



## GQ50 rebar cutting machine manual:

Before using the machine, please read this manual, it helps you know how to operate such a rebar cutting machine in right way.

1. Please make sure it working with 380V 3phase electricity
2. Please make sure inject 8-10kgs machine oil for lubricate the gears
3. Please make sure it working at the right direction as point 5 shows






# Shuanglong Machinery

[www.cgshuanglong.net](http://www.cgshuanglong.net)

[info@cgshuanglong.net](mailto:info@cgshuanglong.net)

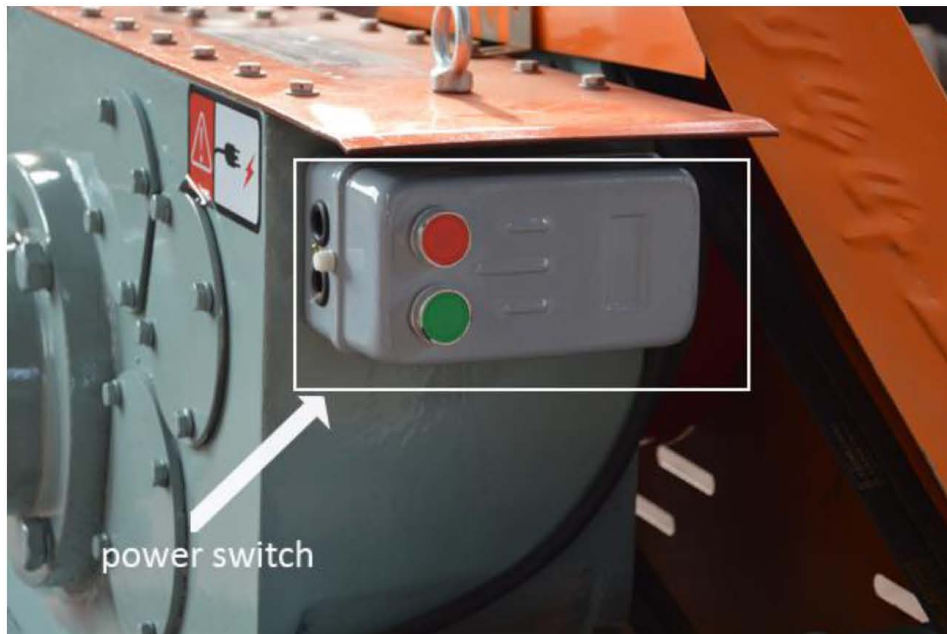



Shuanglong Machinery

[www.cgshuanglong.net](http://www.cgshuanglong.net)

[info@cgshuanglong.net](mailto:info@cgshuanglong.net)

